



TECHNICAL SERVICE BULLETIN

ACCESSORY BELT DRIVE SYSTEM

ACCESSORY BELT DRIVE SYSTEM HONDA

Particular V-6 applications described in Honda Bulletin 08-082 may require a small modification to the front timing cover during replacement of the accessory drive belt tensioner. (Gates part number 38332) The OE now provides an updated tensioner assembly which may cause interference with the front timing cover of some applications. Gates also offers the same, updated design as the OE. The small task is to remove approximately 3mm of plastic material from the front cover, allowing proper clearance.

THIS AREA WILL NEED TO HAVE 3MM OF MATERIAL REMOVED.



IMPROPER INSTALLATION MAY RESULT IN A DAMAGED FRONT TIMING BELT COVER AND IMPROPER ACCESSORY BELT TRACKING, EVENTUALLY LEADING TO BELT FAILURE.

BULLETIN TSB_046_US

PART NUMBER:

- 38332

MAKE:

- Honda

MODEL:


- Accord
- Odyssey
- Pilot
- Ridgeline

YEAR:

- 2003-2007

ENGINE:

- 3.0L
- 3.5L

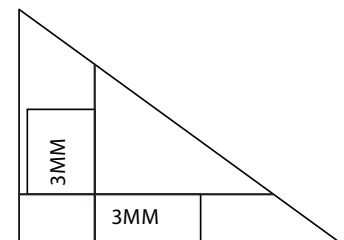

FOLLOW @GATESAUTO

