



Supporting Today's Vehicle Technician



## 22-1014 Port Sizes Appear Too Large

### Application

2002-2009 Buick Rainier, Chevy TrailBlazer, GMC S15 Envoy, Oldsmobile Bravada, and Saab 9-7x.

### Problem

The pressure and return ports appear to be too large for the original lines.

### Cause

The original seals can often stick in the O.E. rack making the ports on the replacement rack appear to be too large due to the seals not being installed.

### Solution

We supply new replacement seals with the rack and pinion. Be sure to install these new seals when making the pressure and return port connection to the rack and pinion. These seals provide the proper fitment for the pressure and return hose while making a tight seal to prevent any fluid leakage while in use.