

CARDONE[™] ProTech[®]


Supporting Today's Vehicle Technician



Ford and International 6.9 Diesel Engines – Mandatory Spacer

Application Ford & International 6.9 Liter Diesel engines CARDONE[™] Part 59-8304 & 59-8305

Problem If the mounting flange on the original pump is 1-1/16" thick at the top two mounting holes and if the replacement unit is 13/16" thick, you must use two 1/8" spacers or 1-1/4" bolts.

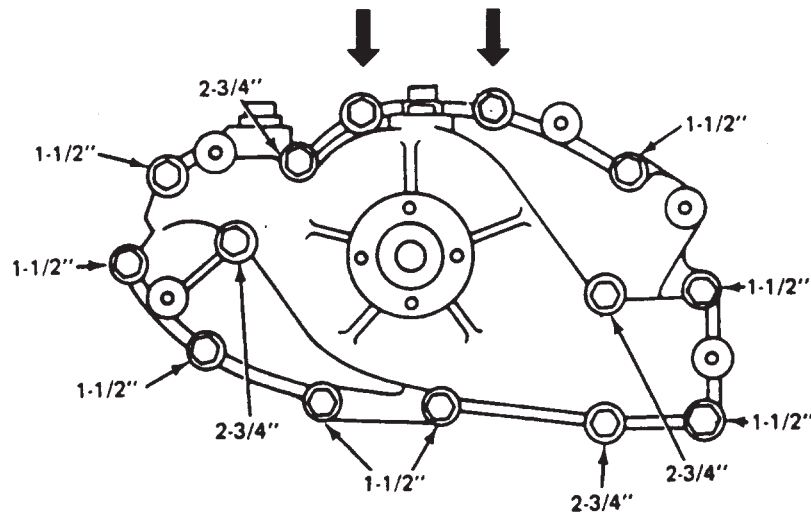

WATER PUMP MOUNTING BOLT LENGTHS & LOCATIONS

Warning IF THIS IS NOT DONE, INJECTOR PUMP FAILURE WILL OCCUR AND VOID THE WATER PUMP WARRANTY.