

CARDONE™ ProTech®

Supporting Today's Vehicle Technician



VIN Entry Problem on R Series Dodge Truck

Application Dodge R Series Trucks Built Prior to July 15, 2003 with Dual Rear Wheels.

Problem Replacing and programming the PCM causes an ABS (antilock brakes) error code.

Cause Some dual rear wheel trucks have a VIN number "3" as sixth character and should have the number "4."

Solution When replacing the PCM, the complete VIN number must be inputted during the programming procedure. **Dual rear wheel vehicles must have a number "4" inputted as the sixth digit, even if the actual VIN has a number "3."** Input a number "4" in place of the "3." If the "3" is inputted, a conflict is likely to occur with the ABS module which will set an error code. This condition does not affect the Flash Reprogramming procedure. Refer to TSB 18-024-02.

3 D 7 M U **3** 8 C 2 3 G 1 2 3 4 5 6

6TH DIGIT MUST BE A "4"

Typical VIN