

CARDON E"


Supporting Today's Vehicle Technician

Difference between 58-147 and 58-320

Application G.M. Water Pumps - CARDONE[™] Part Numbers 58-147 and 58-320.

Problem The original pulley studs or bolts do not fit the replacement unit, causing cross-threaded or stripped hub bolt holes on replacement unit.

- **Cause** Use of incorrect studs in hub bolt holes or the wrong pump.
- **Solution** Verify the water pump application. The pumps are similar except for the tapped hub hole threads.

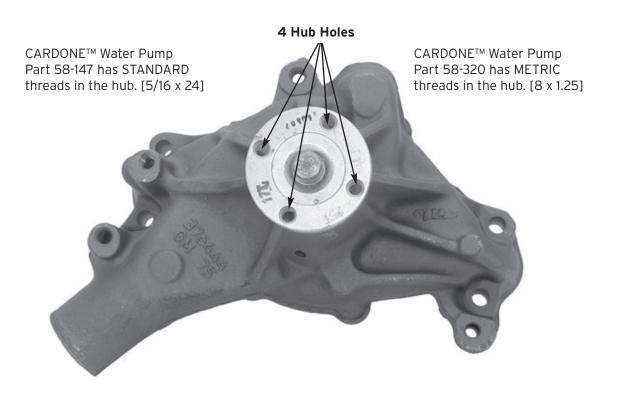

©2020 CARDONE Industries, Inc. ProTech® is a registered trademark owned by CARDONE Industries, Inc. CARDONE™ is a pending trademark registration owned by CARDONE Industries, Inc.

For other ProTech[®] publications, visit www.cardone.com