

CARDONE™ ProTech®

Supporting Today's Vehicle Technician




Overlooked Pressure Hose Seal Causes Power Steering Leaks

Application All Power Steering systems using O-ring seals on fittings.

Problem After replacing the Power Steering Pump or steering unit, leaks develop at fittings.

Cause Original O-rings were not replaced, damaged or not properly installed.

Solution Install all supplied O-ring seals as per installation instructions. Be sure to replace the seal inside the pressure hose.

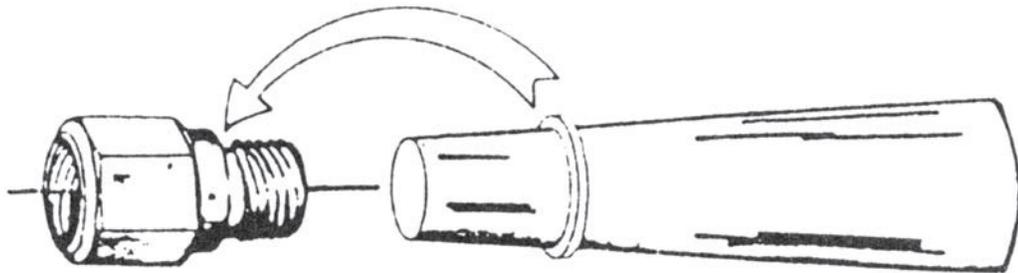

Note Slide pressure hose fitting back and remove old seal. Soften new seal in warm water, expand over a tapered punch, then transfer to hose as shown.